



Site Name	Feature Location	6 D's	Reasons	Existing species	Planting notes	Replant species
WINCOBANK AVENUE	o/s 14	TR: Felling	F/W uplifted by shallow lateral root	Platanus x hispanica	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 14 (same position as felled tree)
WINCOBANK AVENUE	adj 109/opposite 22b	TR: Felling	F/W mounding, roots will be damaged upon planing off	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit opp 22b (same position as felled tree)
WINCOBANK AVENUE	opp 31	TR: Felling	Kerbs and c/w uplifted - will be damaged upon planing off	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit opp 31 (same position as felled tree)
WINCOBANK AVENUE	o/s 31	TR: Felling	F/W mounded by shallow rooting	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 31 (same position as felled tree)
WINCOBANK AVENUE	opp 33-35	TR: Felling	Rooting above tarmac in f/w, will be damaged upon planing off	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit opp33-35 (same position as felled tree)
WINCOBANK AVENUE	adj 123, adj 39	TR: Felling	Stem girdled, structural integrity compromised	Gleditsia triacanthos	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit adjacent to 39 (same position as felled tree)
WINCOBANK AVENUE	opp 39	TR: Felling	Kerbs missing, cannot replace without root damage	Platanus x hispanica	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit opposite 39 (same position as felled tree)
WINCOBANK AVENUE	o/s school, o/s 41a	TR: Felling	Kerbs disrupted and c/w and f/w uplifted	Fraxinus excelsior	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 41a (same position as felled tree)
WINCOBANK AVENUE	o/s 50-52	TR: Felling	Kerbs displaced and f/w damaged	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 50-52 (same position as felled tree)
WINCOBANK AVENUE	o/s 74	TR: Felling	Kerbs disrupted - cannot replace without root damage	Fraxinus excelsior	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 74 (same position as felled tree)
WINCOBANK AVENUE	o/s 76	TR: Felling	Extensive stem wounding @ 2.4m, sapwood exposed, poor specimen	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 76 (same position as felled tree)
WINCOBANK AVENUE	o/s 80 (closer to hall 1 of 2)	TR: Felling	F/W uplifted by shallow rooting	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 80 (same position as felled tree)

WINCOBANK AVENUE	o/s 80 (between 80-82)	TR: Felling	F/W raised by shallow rooting, and kerbs beginning to lift	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 80 (between 80-82) (same position as felled tree)
WINCOBANK AVENUE	o/s 86	TR: Felling	Stem encroaching c/w - wounding from multiple previous strikes	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit o/s 86 (same position as felled tree)
WINCOBANK AVENUE	o/s 130	TR: Felling	F/W uplifted and rooting above tarmac in f/w	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit centrally o/s 128-130 (same position as felled tree)
WINCOBANK AVENUE	o/s churchyard, closest to 148	TR: Felling	F/W mounded by buttress rooting	Acer pseudoplatanus	Gleditsia triacanthos 'Sunburs	Plant in new 800mm pit adjacent to 148, Opposite bus shelter (same position as felled tree)